

Agency:	Gilbert		Title of Project:	Gilbert Rd/Ray Rd Median Offset Improvements	
Date:	4-Nov-19				
Contact Name and Title:		Phone:		E-Mail:	
Casey Ambrose		(480) 503-6619		casey.ambrose@gilbertaz.gov	
Roadway Safety Program (RSP) Project Scope					
1.	Describe your safety improvement project in detail: (50 words or less)				
1a.	Proposed construction improvements include median adjustments to reduce the negative offset left-turn lanes that impact sight distance for left-turning motorists at this intersection.				
2.	Describe the project location, include pertinent demographic and land development information:				
2a.	The median improvements will impact all 4 legs of the intersection. These improvements will impact between approximately 80 feet of median on the eastern leg and 110 feet of median on the western leg. It will impact approximately 130 feet of median as well as the adjacent northbound through lane on the northern leg and approximately 130 feet of median as well as the adjacent southbound through lane on the southern leg.				
3	For projects on State System:	BMP: (Begin Milepost)		EMP: (End Milepost)	
4.	What network screening method was used to identify this project?			<input type="checkbox"/> MAG <input checked="" type="checkbox"/> ADOT <input type="checkbox"/> Other (Below)	
4a	An in-house screening of ALISS data was performed to determine eligibility based on high crash severity segments.				
5.	Was this project identified as a recommendation in a study? If so, what kind? (check all that apply)				
5a	<input type="checkbox"/> RSA <input type="checkbox"/> PA <input type="checkbox"/> SRTS Study <input type="checkbox"/> LASS Study <input checked="" type="checkbox"/> Other				
6.	Was the project identified using an agency adopted predictive safety analysis?			<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO	
7.	What is the safety justification for the proposed project?				
7a	Crash data from the most recent 5 years (2014-2018) shows that there were 96 crashes at this intersection. Thirty of these crashes were left-turn crashes, including 1 fatal, 1 serious injury, 4 minor injury, and 3 possible injury crashes. This data warrants improvements to the intersection in an attempt to decrease the high number of left-turn crashes. The goal of the proposed median improvements is to transition from a negative offset median to a positive offset median at the proposed intersection in order to significantly improve sight distances and allow for drivers to more safely make left-turns.				
8.	Is Public outreach required for your project? If "yes" Provide what was done, the date(s) and outcomes. (Attach documentation if applicable)				
8a	No business or residential access is impacted, therefore public outreach is not necessary for this project.				
9.	What safety related public education will your agency be providing before placing the safety improvement in service, if applicable?				
9a	None specific to median improvements. However, project construction signs will convey this project is for improved roadway safety for all roadway users.				
10.	Equity: Input the largest percent for each element for the one-mile radius or offset (Click on the hyperlinks in the text to open maps. See directions on side on maps):				
	65 yrs and Older	Minority Groups	No Vehicle Households	Disabled	Living in Poverty
10a	22%	56%	4.1%	8.3%	6.6%
11.	Avg Daily Traffic (ADT) Volume:		41,000	Year Collected:	
12.	Total Crash Frequency:		96	Crash Rate (MVM or MEV):	
13.	What is the posted speed limit?		45 MPH	Benefit/Cost:	
				33.6	

PROJECT COST ESTIMATE WORKSHEET

(Cost Estimates Are Required Regardless of Programming)

DESIGN	REQUESTED PROGRAMMING <small>(Complete if Item will be programmed in the MAG TIP)</small>	Location Description	Gilbert Road and Ray Road Intersection			
		Work Description	Median Offset Improvements			
		Funding Source	Local			
		Preferred Year to Program Work	2019			
COST ESTIMATE FOR DESIGN			UNITS	QUANTITY	UNIT COST	TOTAL
DESIGN	PRELIMINARY ENGINEERING <small>(15% plans) (Required for Budget)</small>					\$ -
		Design Concept Report (DCR)	LS			\$ -
		Federal Project Environmental Determination	LS			\$ -
		HAZMAT Assessment	LS			\$ -
		SUBTOTAL - PRELIMINARY ENGINEERING COSTS				
	FINAL DESIGN <small>(30, 60, 95, 100% plans) (Required for Budget)</small>	Plans, Specifications, Cost Estimates, Bidding	LS	1	26,500.00	\$ 26,500.00
		Geotechnical Report	LS			\$ -
		Drainage Report	LS			\$ -
		SWPPP	LS			\$ -
		SUBTOTAL - FINAL DESIGN COSTS				
TOTAL PRELIMINARY ENGINEERING AND DESIGN COST AVAILABLE FOR PROGRAMMING						\$ 26,500.00
CONSTRUCTION	REQUESTED PROGRAMMING <small>(Complete only if Construction will be programmed in the MAG TIP)</small>	Location Description	Gilbert Road and Ray Road Intersection			
Work Description		Median Offset Improvements				
Funding Source		RSP				
Preferred Year to Program Work		2020				
COST ESTIMATE FOR CONSTRUCTION			UNITS	QUANTITY	UNIT COST	TOTAL
CONSTRUCTION <small>(Required for Budget)</small>		TOPOGRAPHIC SURVEY	HOUR	20	175.00	\$ 3,500.00
		CONTRACTOR PROVIDED MATERIAL TESTING (FIELD DENSITY TESTS)	HOUR	8	90.00	\$ 720.00
		CONTRACTOR PROVIDED MATERIAL TESTING (CONCRETE CYLINDERS)	EA	2	100.00	\$ 200.00
		FURNISH AND INSTALL AC PAVEMENT 2" A-12.5 3" A-19 OVER 12" ABC	SY	467	96.00	\$ 44,832.00
		FURNISH AND INSTALL AC PAVEMENT 2" A-12.5 3" A-19 WITH ABC LEVELING COURSE	SY	532	63.00	\$ 33,516.00
		FURNISH AND INSTALL CONCRETE CURB AND GUTTER, MAG STANDARD DETAIL 220	LF	26	27.00	\$ 702.00
		FURNISH AND INSTALL SINGLE CURB, MAG STANDARD DETAIL 222, TYPE A	LF	259	23.00	\$ 5,957.00
		MEDIAN NOSE TRANSITION, MAG DTL 223	EA	4	1,000.00	\$ 4,000.00
		MEDIAN PAVING, BRICK PAVERS	SF	233	15.00	\$ 3,495.00
		MANHOLE FRAME & COVER ADJUSTMENT, MAG DTL 422	EA	2	575.00	\$ 1,150.00
		REMOVE OR ADJUST NO. 3 1/2 PULL BOX	EA	2	250.00	\$ 500.00
		REMOVE AND DISPOSE ASPHALTIC PAVEMENT	SF	1,986	3.11	\$ 6,176.46
		REMOVE EXISTING ASPHALT CONCRETE PAVEMENT BY MILLING	SY	532	16.00	\$ 8,512.00
		REMOVE AND DISPOSE CONCRETE MEDIAN NOSE	SF	76	6.00	\$ 456.00
		REMOVE AND DISPOSE CONCRETE CURB AND GUTTER	LF	811	4.00	\$ 3,244.00
		REMOVE EXISTING CONCRETE STREET LIGHT FOUNDATION AND BACKFILL AND/OR GRADE WITH PROPER MATERIAL	EA	2	1,950.00	\$ 3,900.00
		REMOVE EXISTING MEDIAN PAVERS	SF	1,066	2.00	\$ 2,132.00
		REMOVE "MEDIAN OR BEHIND CURB ARTERIAL" STREET LIGHT POLE, MAST ARM, LUMINAIRE AND HARDWARE	EA	2	475.00	\$ 950.00
		FURNISH AND INSTALL CONCRETE "ARTERIAL - MEDIAN" STREET LIGHT FOUNDATION WITH GROUNDING WIRE AND PLATE, ANCHOR BOLTS, CONDUIT AND REINFORCEMENT	EA	2	2,175.00	\$ 4,350.00
		FURNISH AND INSTALL "MEDIAN - 40' HIGH" GIL-906 ARTERIAL STREET LIGHT POLE, MAST ARM, WIRING FROM JUNCTION BOX AND HARDWARE	EA	2	3,550.00	\$ 7,100.00
		ELECTRICAL CONDUIT, CONDUCTORS AND BOND WIRES (STREET LIGHTS)	LF	50	30.00	\$ 1,500.00
		FURNISH AND INSTALL NO. 3 1/2 PULL BOX	EA	2	425.00	\$ 850.00
		FURNISH AND INSTALL GE 108W LED LUMINAIRE	EA	4	1,050.00	\$ 4,200.00
		YELLOW THERMOPLASTIC TRAFFIC MARKINGS (4" EQUIVALENT)	LF	528	0.75	\$ 396.00
		WHITE THERMOPLASTIC TRAFFIC MARKINGS (4" EQUIVALENT)	LF	1,942	0.75	\$ 1,456.50
		THERMOPLASTIC STOP BARS AND CROSSWALKS (4" EQUIVALENT)	LF	443	2.50	\$ 1,107.50
		TEMPORARY PAINTED STRIPING (4" WIDE, 10 MIL THICK)	LF	1,082	0.40	\$ 432.80
		PAINT BULL NOSE	EA	4	125.00	\$ 500.00
		RAISED PAVEMENT MARKER, LARGE CHANNEL MARKER, 2-WAY REFLECTIVITY	EA	129	100.00	\$ 12,900.00
		PAVEMENT MARKER FOR HYDRANT, (TYPE M - BLUE 2-WAY)	EA	4	5.00	\$ 20.00

PROJECT COST ESTIMATE WORKSHEET
(Cost Estimates Are Required Regardless of Programming)

		RAISED PAVEMENT MARKER, ADOT (TYPE G - CLEAR 1-WAY)	EA	52	5.00	\$	260.00	
		FURNISH AND INSTALL ROADWAY SIGN PANELS	SF	27	35.00	\$	945.00	
		FURNISH AND INSTALL ROADWAY SIGN POST, TOG STANDARD DETAIL GIL-227	LF	48	12.50	\$	600.00	
		FURNISH AND INSTALL ROADWAY SIGN FOUNDATION, TOG STANDARD DETAIL GIL-227	EA	4	225.00	\$	900.00	
		REMOVE AND SALVAGE EXISTING SIGNS AND POSTS	EA	8	100.00	\$	800.00	
		SUBTOTAL - CONSTRUCTION COST					\$	162,260.26
	MOBILIZATION AND ADMINISTRATION COSTS	CONTRACTOR MOBILIZATION (Typically 8% of construction cost)				LS	\$	8,000.00
		TRAFFIC CONTROL (0-8% of construction cost)				LS	\$	37,000.00
		CONSTRUCTION CONTINGENCIES (Typically 5% of construction cost)				5%	\$	8,113.01
		CONSTRUCTION ADMINISTRATION (Averaging 18% of construction cost)				LS	\$	21,500.00
		SUBTOTAL - MOBILIZATION & ADMINISTRATION COSTS					\$	74,613.01
	TOTAL UTILITIES, CONSTRUCTION AND MOBILIZATION FOR PROGRAMMING						\$	236,873.27
TOTAL COST ESTIMATE							\$	263,373

Budget and Signature Page

Please describe the agency programming of this project in the agency's CIP


This project is in the City's FY 2020-2029 CIP.

Phase	Location Description	Work Description	Year to be Programmed	Funding Source	Amount
Design	Gilbert Road and Ray Road Intersection	Median Offset Improvements	2019	Local	\$ 26,500
Construction	Gilbert Road and Ray Road Intersection	Median Offset Improvements	2020	RSP	\$ 236,873
Total Cost					\$ 263,373

Signature: To be signed with printed hard copy that is sent to MAG

As the jurisdiction's manager/administrator or designated representative, I certify that the information contained in this application is accurate and complete and that the local funds for this project will be included in the Lead Agency's local current CIP/TIP or budget document if the project is selected for MAG Roadway Safety Program funding. I also certify the Lead Agency's commitment to maintain or operate the facility.

Signature:

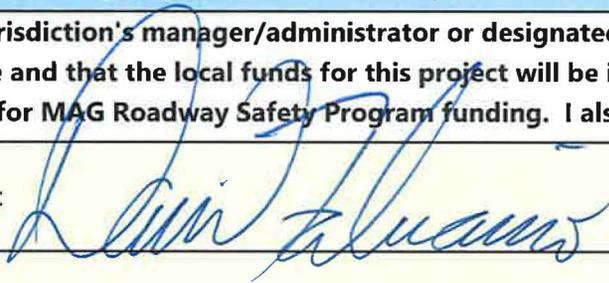

Name: David Fabiano, PE

Title: Town Engineer

Date: November 4, 2019

RSP Application Benefit-Cost Tabulation Sheet

Agency:	Gilbert	Title of Project:	Gilbert Rd/Ray Rd Median Offset Improvements
----------------	---------	--------------------------	--

Annual Benefit Tabulation

Severity	Annual Average	Estimated CRF* Reduction	Total Reduction	Unit Cost	Annual Benefit
Fatal	0.20	36%	0.07	\$9,515,371	\$685,107
Incapacitating Injury	0.60	36%	0.22	\$550,499	\$118,908
Non-Incapacitating	1.20	36%	0.43	\$149,132	\$64,425
Possible Injury	1.20	36%	0.43	\$103,145	\$44,559
Total Annual Benefits					\$912,998

Costs

Total Project Cost	\$263,373	
Project Life (years)	20	
Interest Rate (%)	8%	
Capital Recovery Factor	0.1019	
Annual Construction Cost	\$26,825	
Annual Maintenance Cost	\$300.00	
Total Annual Costs		\$27,125

Benefit / Cost

Annual Benefit	Annual cost	Benefit / Cost Ratio
\$912,998	\$27,125	33.6


List CMF(s) Used in the field below and its associated countermeasure(s)


CMF Used: Improve left-turn lane offset to create positive offset (ID: 6096) = 0.64

Gilbert				Gilbert Rd/Ray Rd Median Offset Improvements				RSP App V1 2019																		
Incident ID	Incident Date & Time	Incident On Road	Incident Crossing Feature	Incident Offset	Incident Severity Description	Incident First Harmful Description	Incident Collision Manner Desc	Incident Light Condition Desc	Incident Weather Desc	Incident Intersection Type Desc	Incident Junction Relation Desc	Incident Traffic Way Type Desc	Unit Travel Direction Desc	Unit Action Desc	Unit Road Condition Desc1	Unit Surface Condition Desc1	Unit Env Condition Desc1	Unit Defect Desc1	Unit Number	Unit Event Sequence Desc1	Unit Event Sequence Desc2	Person Type Desc	Person Safety Device Desc	Person Violation Desc1	Person Physical Desc0	
1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	25	26	27	28	
2796253	1/1/2014 12:27:00 PM	07 GILBERT RD	Ray Rd		0 Suspected Minor Injury	Motor Vehicle In Transport	Left Turn	Daylight	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	4 - West	Making Left Turn		Dry	Moving Vehicle		1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Other	0 - No Apparent Influence	
2795667	1/5/2014 6:12:00 PM	07 RAY RD	Gilbert Rd		100	No Injury	Motor Vehicle In Transport	Rear End	Dark Lighted	Clear	Not At An Intersection	Not Junction Related	Two Way Not Divided With Continuous Left Turn Lane	4 - West	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Speed To Fast For Conditions	0 - No Apparent Influence
2802876	1/19/2014 10:13:00 AM	07 GILBERT RD	Ray Rd		0	Possible Injury	Motor Vehicle In Transport	Left Turn	Daylight	Cloudy	Four Way Intersection	Intersection Non Interchange	Two Way Not Divided	7 - Southwest	Making Left Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Made Improper Turn	0 - No Apparent Influence
2806347	2/11/2014 4:06:00 PM	07 GILBERT RD	Ray Rd		0	No Injury	Pedalcycle	Angle (Front To Side)(Other Than Left Turn)	Daylight	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Not Divided With Continuous Left Turn Lane	1 - North	Crossing Road	No Contributing Circumstances	Dry	No Contributing Circumstances		1	Motor Vehicle In Transport	Pedalcyclist	Helmet Used	Unknown	0 - No Apparent Influence	
2815389	3/7/2014 6:29:00 AM	07 RAY RD	Gilbert Rd		150	No Injury	Motor Vehicle In Transport	Rear End	Dawn	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	4 - West	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Unknown	Speed To Fast For Conditions	0 - No Apparent Influence
2820855	3/21/2014 6:26:00 PM	07 RAY RD	Gilbert Rd		45	No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Not At An Intersection	Not Junction Related	Two Way Divided Positive Median Barrier	4 - West	Going Straight Ahead		Dry	Glare Sunlight		1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Speed To Fast For Conditions	0 - No Apparent Influence
2840871	5/15/2014 7:55:00 AM	07 RAY RD	Gilbert Rd		-30	No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	3 - East	Going Straight Ahead		Dry	Moving Vehicle		1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Inattention Distraction	0 - No Apparent Influence
2839436	5/21/2014 5:27:00 PM	07 GILBERT RD	Ray Rd		0	No Injury	Motor Vehicle In Transport	Angle (Front To Side)(Other Than Left Turn)	Daylight	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	4 - West	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	No Improper Action	0 - No Apparent Influence
2847615	6/21/2014 9:58:00 AM	07 GILBERT RD	Ray Rd		-98	Possible Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	1 - North	Going Straight Ahead	Other	Dry	Other	Other	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Speed To Fast For Conditions	0 - No Apparent Influence
2859747	7/29/2014 12:26:00 PM	07 GILBERT RD	Ray Rd		0	No Injury	Motor Vehicle In Transport	Angle (Front To Side)(Other Than Left Turn)	Daylight	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	2 - South	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Inattention Distraction	0 - No Apparent Influence
2868305	8/25/2014 5:28:00 PM	07 RAY RD	Gilbert Rd		-100	No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Not At An Intersection	Not Junction Related	Two Way Divided Positive Median Barrier	3 - East	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Inattention Distraction	0 - No Apparent Influence
2872332	9/13/2014 4:53:00 PM	07 RAY RD	Gilbert Rd		-35	No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	3 - East	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Speed To Fast For Conditions	0 - No Apparent Influence
2890465	11/7/2014 9:22:00 PM	07 GILBERT RD	Ray Rd		0	Suspected Minor Injury	Motor Vehicle In Transport	Angle (Front To Side)(Other Than Left Turn)	Dark Lighted	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	2 - South	Making Left Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Air Bag Deployed/Shoulder-Lap Belt	Failed To Yield Right Of Way	0 - No Apparent Influence
2896661	11/18/2014 10:11:00 AM	07 GILBERT RD	Ray Rd		0	No Injury	Motor Vehicle In Transport	Left Turn	Daylight	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	5 - Northwest	Making Left Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Failed To Yield Right Of Way	0 - No Apparent Influence
2897364	12/1/2014 6:57:00 AM	07 RAY RD	Gilbert Rd		100	No Injury	Motor Vehicle In Transport	Rear End	Daylight	Cloudy	Not At An Intersection	Not Junction Related	Two Way Divided Positive Median Barrier	3 - East	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Followed Too Closely	0 - No Apparent Influence
2906398	12/11/2014 5:53:00 PM	07 RAY RD	Gilbert Rd		-40	No Injury	Motor Vehicle In Transport	Rear End	Dark Lighted	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	3 - East	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Followed Too Closely	0 - No Apparent Influence
2906554	12/13/2014 7:35:00 PM	07 GILBERT RD	Ray Rd		15	No Injury	Motor Vehicle In Transport	Other	Dark Lighted	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	1 - North	Making Right Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Speed To Fast For Conditions	0 - No Apparent Influence
2906229	12/15/2014 11:32:00 AM	07 RAY RD	Gilbert Rd		30	No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Four Way Intersection	Frontage Road Interchange	Two Way Divided Unprotected Painted 4 Feet Median	4 - West	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Followed Too Closely	0 - No Apparent Influence
2914810	1/10/2015 8:02:00 PM	07 GILBERT RD	Ray Rd		0	No Injury	Motor Vehicle In Transport	Left Turn	Dark Lighted	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	2 - South	Making Left Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Failed To Yield Right Of Way	0 - No Apparent Influence
2915132	1/10/2015 8:58:00 PM	07 GILBERT RD	Ray Rd		0	No Injury	Parked Motor Vehicle	Rear End	Dark Lighted	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	1 - North	Backing	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Parked Motor Vehicle		Driver	Unknown	Other	0 - No Apparent Influence
2930628	2/19/2015 7:46:00 PM	07 RAY RD	Gilbert Rd		0	Fatal	Motor Vehicle In Transport	Left Turn	Dark Lighted	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	4 - West	Making Left Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Made Improper Turn	0 - No Apparent Influence
2939449	3/28/2015 6:52:00 PM	07 RAY RD	Gilbert Rd		-100	Suspected Minor Injury	Motor Vehicle In Transport	Left Turn	Dusk	Clear	Not At An Intersection	Not Junction Related	Two Way Divided Unprotected Painted 4 Feet Median	2 - South	Making Left Turn	Other	Dry	Other	Other	1	Motor Vehicle In Transport		Driver	Air Bag Deployed/Shoulder-Lap Belt	Failed To Yield Right Of Way	0 - No Apparent Influence
2942589	3/28/2015 10:38:00 PM	07 RAY RD	Gilbert Rd		0	No Injury	Motor Vehicle In Transport	Left Turn	Dark Lighted	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	3 - East	Making Left Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Failed To Yield Right Of Way	0 - No Apparent Influence
2950307	4/13/2015 12:14:00 PM	07 RAY RD	Gilbert Rd		-20	No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	4 - West	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Followed Too Closely	0 - No Apparent Influence
2957621	5/9/2015 1:47:00 PM	07 GILBERT RD	Ray Rd		80	No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	2 - South	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Speed To Fast For Conditions	0 - No Apparent Influence
2960339	5/26/2015 10:27:00 AM	07 GILBERT RD	Ray Rd		0	Suspected Minor Injury	Motor Vehicle In Transport	Angle (Front To Side)(Other Than Left Turn)	Daylight	Clear	Four Way Intersection	Intersection Interchange	Two Way Divided Positive Median Barrier	1 - North	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Disregarded Traffic Signal	0 - No Apparent Influence
2981229	7/30/2015 11:32:00 AM	07 RAY RD	Gilbert Rd		100	No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	4 - West	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Followed Too Closely	0 - No Apparent Influence
2981225	7/31/2015 3:01:00 PM	07 RAY RD	Gilbert Rd		-200	No Injury	Motor Vehicle In Transport	Sideways Same Direction	Daylight	Cloudy	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	3 - East	Changing Lanes	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Speed To Fast For Conditions	0 - No Apparent Influence
2986974	8/20/2015 4:25:00 AM	07 RAY RD	Gilbert Rd		0	No Injury	Motor Vehicle In Transport	Left Turn	Dark Lighted	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Not Divided	3 - East	Making Left Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Unknown	Disregarded Traffic Signal	0 - No Apparent Influence
2993414	9/2/2015 7:55:00 AM	07 RAY RD	Gilbert Rd		75	No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Unknown	Not Junction Related	Two Way Divided Positive Median Barrier	4 - West	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Followed Too Closely	0 - No Apparent Influence
3014948	11/6/2015 2:18:00 PM	07 GILBERT RD	Ray Rd		0	Suspected Serious Injury	Motor Vehicle In Transport	Angle (Front To Side)(Other Than Left Turn)	Daylight	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	3 - East	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Disregarded Traffic Signal	0 - No Apparent Influence
3018844	11/23/2015 9:54:00 AM	07 GILBERT RD	Ray Rd		0	No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Four Way Intersection	Intersection Interchange	Two Way Divided Positive Median Barrier	3 - East	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Disregarded Traffic Signal	0 - No Apparent Influence
3027813	12/11/2015 3:43:00 PM	07 GILBERT RD	Ray Rd		-75	No Injury	Motor Vehicle In Transport	Sideways Same Direction	Daylight	Cloudy	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	1 - North	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Failed To Keep In Proper Lane	0 - No Apparent Influence
3030545	12/16/2015 2:48:00 PM	07 RAY RD	Gilbert Rd		200	Suspected Minor Injury	Utility Pole Light Support	Single Vehicle	Daylight	Clear	Not At An Intersection	Not Junction Related	Two Way Divided Positive Median Barrier	3 - East	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Utility Pole Light Support		Driver	Lap Belt	Failed To Keep In Proper Lane	0 - No Apparent Influence
3072838	4/8/2016 12:43:00 PM	07 GILBERT RD	Ray Rd		0	No Injury	Motor Vehicle In Transport	Angle (Front To Side)(Other Than Left Turn)	Daylight	Clear	Not At An Intersection	Not Junction Related	Unknown	1 - North	Going Straight Ahead	Unknown	Dry	Unknown	Unknown	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Unknown	0 - No Apparent Influence
3080642	4/23/2016 7:29:00 PM	07 GILBERT RD	Ray Rd		-75	No Injury	Motor Vehicle In Transport	Rear End	Dark Lighted	Clear	Not At An Intersection	Not Junction Related	Two Way Divided Positive Median Barrier	1 - North	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Speed To Fast For Conditions	0 - No Apparent Influence

Gilbert		Gilbert Rd/Ray Rd Median Offset Improvements										RSP App V1_2019													
Incident ID	Incident Date & Time	Incident On Road	Incident Crossing Feature	Incident Offset	Incident Injury Severity Description	Incident First Harmful Description	Incident Collision Manner Desc	Incident Light Condition Desc	Incident Weather Desc	Incident Intersection Type Desc	Incident Junction Relation Desc	Incident Traffic Way Type Desc	Unit Travel Direction Desc	Unit Action Desc	Unit Road Condition Desc1	Unit Surface Condition Desc1	Unit Env Condition Desc1	Unit Defect Desc1	Unit Number	Unit Event Sequence Desc1	Unit Event Sequence Desc2	Person Type Desc	Person Safety Device Desc	Person Violation Desc1	Person Physical Desc0
1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	25	26	27	28
310529	7/1/2016 4:18:00 PM	07 GILBERT RD	Ray Rd	150	No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	2 - South	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Speed To Fast For Conditions	0 - No Apparent Influence
3115271	7/28/2016 2:11:00 PM	07 GILBERT RD	Ray Rd	0	Suspected Serious Injury	Motor Vehicle In Transport	Left Turn	Daylight	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	4 - West	Making Left Turn		Dry	Stopped Parked Vehicle		1	Motor Vehicle In Transport		Driver	Air Bag Deployed/Shoulder-Lap Belt	Failed To Yield Right Of Way	0 - No Apparent Influence
3118749	8/15/2016 3:23:00 PM	07 GILBERT RD	Ray Rd	-10	No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Not At An Intersection	Not Junction Related	Two Way Divided Positive Median Barrier	1 - North	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Speed To Fast For Conditions	0 - No Apparent Influence
3165859	12/3/2016 8:26:00 PM	07 GILBERT RD	Ray Rd	-10	No Injury	Overtum Rollover	Single Vehicle	Dark Lighted	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	2 - South	Going Straight Ahead	Unknown	Dry	Unknown	Unknown	1	Overtum Rollover		Driver	None Used	No Improper Action	0 - No Apparent Influence
3169785	12/13/2016 5:13:00 PM	07 GILBERT RD	Ray Rd	0	No Injury	Motor Vehicle In Transport	Left Turn	Dusk	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Not Divided With Continuous Left Turn Lane	2 - South	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Disregarded Traffic Signal	0 - No Apparent Influence
3172910	12/24/2016 2:14:00 PM	07 RAY RD	Gilbert Rd	50	No Injury	Motor Vehicle In Transport	Angle (Front To Side)(Other Than Left Turn)	Daylight	Rain	Not Reported	Driveway	Two Way Divided Positive Median Barrier	1 - North	Making Right Turn	No Contributing Circumstances	Wet	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Failed To Yield Right Of Way	0 - No Apparent Influence
3178813	1/8/2017 10:16:00 AM	07 GILBERT RD	Ray Rd	0	No Injury	Motor Vehicle In Transport	Left Turn	Daylight	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	2 - South	Making Left Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Unknown	0 - No Apparent Influence
3181764	1/13/2017 7:27:00 AM	07 GILBERT RD	Ray Rd	0	No Injury	Motor Vehicle In Transport	Left Turn	Daylight	Cloudy	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	1 - North	Making Left Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Failed To Yield Right Of Way	0 - No Apparent Influence
3193228	2/10/2017 4:55:00 PM	07 GILBERT RD	Ray Rd	150	No Injury	Motor Vehicle In Transport	Sideswipe Same Direction	Daylight	Clear	Not At An Intersection	Not Junction Related	Two Way Divided Positive Median Barrier	2 - South	Making U Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Unsafe Lane Change	0 - No Apparent Influence
3199423	2/24/2017 4:13:00 PM	07 RAY RD	Gilbert Rd	-100	No Injury	Motor Vehicle In Transport	Sideswipe Same Direction	Daylight	Clear	Not At An Intersection	Not Junction Related	Two Way Not Divided With Continuous Left Turn Lane	3 - East	Going Straight Ahead	Unknown	Dry	Unknown	Unknown	1	Motor Vehicle In Transport		Driver	Unknown	Unsafe Lane Change	
3204368	3/9/2017 9:54:00 AM	07 RAY RD	Gilbert Rd	40	No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	4 - West	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Followed Too Closely	0 - No Apparent Influence
3204225	3/10/2017 10:13:00 AM	07 GILBERT RD	Ray Rd	-185	No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	2 - South	Changing Lanes	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Unsafe Lane Change	0 - No Apparent Influence
3206541	3/16/2017 10:43:00 AM	07 GILBERT RD	Ray Rd	0	No Injury	Motor Vehicle In Transport	Left Turn	Daylight	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	1 - North	Making Left Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Failed To Yield Right Of Way	0 - No Apparent Influence
3219281	4/20/2017 6:01:00 PM	07 RAY RD	Gilbert Rd	-100	No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	4 - West	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Speed To Fast For Conditions	0 - No Apparent Influence
3220256	4/24/2017 7:58:00 AM	07 GILBERT RD	Ray Rd	-75	No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	1 - North	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Speed To Fast For Conditions	0 - No Apparent Influence
3226270	5/10/2017 4:27:00 PM	07 RAY RD	Gilbert Rd	15	No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	3 - East	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Speed To Fast For Conditions	0 - No Apparent Influence
3230967	5/21/2017 1:34:00 PM	07 RAY RD	Gilbert Rd	200	No Injury	Motor Vehicle In Transport	Sideswipe Same Direction	Daylight	Clear	T Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	4 - West	Making U Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Unknown	0 - No Apparent Influence
3249345	7/11/2017 1:39:00 PM	07 GILBERT RD	Ray Rd	0	No Injury	Motor Vehicle In Transport	Angle (Front To Side)(Other Than Left Turn)	Daylight	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	2 - South	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Disregarded Traffic Signal	0 - No Apparent Influence
3249880	7/12/2017 8:32:00 AM	07 RAY RD	Gilbert Rd	-40	No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Not At An Intersection	Not Junction Related	Two Way Divided Positive Median Barrier	4 - West	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Followed Too Closely	0 - No Apparent Influence
3249895	7/17/2017 4:24:00 AM	07 GILBERT RD	Ray Rd	0	Possible Injury	Motor Vehicle In Transport	Angle (Front To Side)(Other Than Left Turn)	Daylight	Clear	Four Way Intersection	Intersection Interchange	Two Way Divided Positive Median Barrier	4 - West	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Speed To Fast For Conditions	0 - No Apparent Influence
3251391	7/17/2017 11:46:00 PM	07 RAY RD	Gilbert Rd	0	No Injury	Motor Vehicle In Transport	Left Turn	Dark Lighted	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Not Divided Positive Median Barrier	6 - Northeast	Making Left Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Failed To Yield Right Of Way	0 - No Apparent Influence
3253137	7/25/2017 4:28:00 PM	07 GILBERT RD	Ray Rd	0	No Injury	Motor Vehicle In Transport	Left Turn	Daylight	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	2 - South	Making U Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Failed To Yield Right Of Way	0 - No Apparent Influence
3256536	7/28/2017 8:39:00 AM	07 RAY RD	Gilbert Rd	0	No Injury	Motor Vehicle In Transport	Left Turn	Daylight	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	4 - West	Making Left Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Failed To Yield Right Of Way	0 - No Apparent Influence
3256530	7/31/2017 3:55:00 PM	07 RAY RD	Gilbert Rd	-25	No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	3 - East	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Speed To Fast For Conditions	0 - No Apparent Influence
3259966	8/12/2017 8:17:00 PM	07 GILBERT RD	Ray Rd	0	No Injury	Motor Vehicle In Transport	Left Turn	Dark Lighted	Cloudy	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	6 - Northeast	Making Left Turn	Unknown	Dry	Unknown	Unknown	1	Motor Vehicle In Transport	Cross Median	Driver	Unknown	Other	
3285976	10/17/2017 5:13:00 PM	07 GILBERT RD	Ray Rd	-150	No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Unknown	Not Junction Related	Two Way Divided Positive Median Barrier	1 - North	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Speed To Fast For Conditions	0 - No Apparent Influence
3286468	10/20/2017 8:45:00 PM	07 RAY RD	Gilbert Rd	25	No Injury	Motor Vehicle In Transport	Rear End	Dark Lighted	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	4 - West	Going Straight Ahead	Unknown	Dry	Unknown	Unknown	1	Motor Vehicle In Transport		Driver	Unknown	Speed To Fast For Conditions	
3291831	11/1/2017 3:19:00 PM	07 GILBERT RD	Ray Rd	0	No Injury	Motor Vehicle In Transport	Left Turn	Daylight	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	3 - East	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Air Bag Deployed/Shoulder-Lap Belt	No Improper Action	0 - No Apparent Influence
3302897	11/22/2017 7:57:00 AM	07 RAY RD	Gilbert Rd	50	No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	4 - West	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Followed Too Closely	0 - No Apparent Influence
3305532	12/6/2017 4:16:00 PM	07 GILBERT RD	Ray Rd	0	No Injury	Motor Vehicle In Transport	Left Turn	Daylight	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	1 - North	Making Left Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Failed To Yield Right Of Way	0 - No Apparent Influence
3306825	12/6/2017 5:42:00 PM	07 GILBERT RD	Ray Rd	0	No Injury	Motor Vehicle In Transport	Other	Dark Lighted	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	1 - North	Making Left Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	No Improper Action	0 - No Apparent Influence
3305540	12/8/2017 4:30:00 PM	07 RAY RD	Gilbert Rd	20	No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Not At An Intersection	Not Junction Related	Two Way Divided Positive Median Barrier	3 - East	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Followed Too Closely	0 - No Apparent Influence
3316865	12/28/2017 2:11:00 PM	07 GILBERT RD	Ray Rd	-30	No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Not At An Intersection	Not Junction Related	Two Way Divided Positive Median Barrier	1 - North	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Speed To Fast For Conditions	0 - No Apparent Influence
333414	1/25/2018 4:45:00 PM	07 RAY RD	Gilbert Rd	-75	No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Not At An Intersection	Not Junction Related	Two Way Divided Positive Median Barrier	3 - East	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Speed To Fast For Conditions	0 - No Apparent Influence
3334131	2/9/2018 10:19:00 PM	07 GILBERT RD	Ray Rd	0	No Injury	Motor Vehicle In Transport	Left Turn	Dark Lighted	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	5 - Northwest	Making Left Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Disregarded Traffic Signal	0 - No Apparent Influence
3342910	3/6/2018 3:02:00 PM	07 GILBERT RD	Ray Rd	0	No Injury	Motor Vehicle In Transport	Sideswipe Same Direction	Daylight	Clear	Four Way Intersection	Intersection Interchange	Two Way Divided Positive Median Barrier	3 - East	Avoiding Vehicle Object Pedestrian		Dry	Moving Vehicle		1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	No Improper Action	0 - No Apparent Influence

Gilbert		Gilbert Rd/Ray Rd Median Offset Improvements										RSP App V1_2019													
Incident ID	Incident Date & Time	Incident On Road	Incident Crossing Feature	Incident Offset	Incident Injury Severity Description	Incident First Harmful Description	Incident Collision Manner Desc	Incident Light Condition Desc	Incident Weather Desc	Incident Intersection Type Desc	Incident Junction Relation Desc	Incident Traffic Way Type Desc	Unit Travel Direction Desc	Unit Action Desc	Unit Road Condition Desc1	Unit Surface Condition Desc1	Unit Env Condition Desc1	Unit Defect Desc1	Unit Number	Unit Event Sequence Desc1	Unit Event Sequence Desc2	Person Type Desc	Person Safety Device Desc	Person Violation Desc1	Person Physical Desc0
1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	25	26	27	28
3342360	3/8/2018 3:33:00 PM	07 GILBERT RD	Ray Rd		30 No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	2 - South	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Speed To Fast For Conditions	0 - No Apparent Influence
3347964	3/17/2018 10:34:00 PM	07 GILBERT RD	Ray Rd		0 No Injury	Motor Vehicle In Transport	Left Turn	Dark Lighted	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Not Divided Turn Lane	2 - South	Making Left Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Cross Centerline		Driver	Air Bag Deployed/Shoulder-Lap Belt	Failed To Yield Right Of Way	0 - No Apparent Influence
3355668	4/1/2018 1:30:00 PM	07 GILBERT RD	Ray Rd		50 No Injury	Motor Vehicle In Transport	Sidewipe Same Direction	Daylight	Clear	Not At An Intersection	Not Junction Related	Two Way Divided Positive Median Barrier	1 - North	Changing Lanes	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Unsafe Lane Change	0 - No Apparent Influence
3379203	5/29/2018 3:59:00 PM	07 RAY RD	Gilbert Rd		-50 No Injury	Motor Vehicle In Transport	Sidewipe Same Direction	Daylight	Clear	Not At An Intersection	Not Junction Related	Two Way Divided Unprotected Painted 4 Feet Median	4 - West	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	No Improper Action	0 - No Apparent Influence
3378304	5/31/2018 5:37:00 AM	07 GILBERT RD	Ray Rd		0 Suspected Serious Injury	Pedalcycle	Angle (Front To Side)(Other Than Left Turn)	Daylight	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Not Divided With Continuous Left Turn Lane	1 - North	Crossing Road	Unknown	Dry	Unknown		1	Motor Vehicle In Transport		Pedalcyclist	Helmet Used	Disregarded Traffic Signal	
3387845	6/26/2018 10:10:00 AM	07 GILBERT RD	Ray Rd		-50 No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	1 - North	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Air Bag Deployed/Shoulder-Lap Belt	Followed Too Closely	0 - No Apparent Influence
3391108	7/9/2018 7:44:00 AM	07 RAY RD	Gilbert Rd		50 Possible Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Unprotected Painted 4 Feet Median	4 - West	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Speed To Fast For Conditions	0 - No Apparent Influence
3395159	7/12/2018 9:20:00 AM	07 GILBERT RD	Ray Rd		0 No Injury	Motor Vehicle In Transport	Left Turn	Daylight	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	5 - Northwest	Making Left Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Failed To Yield Right Of Way	0 - No Apparent Influence
3408205	8/27/2018 4:13:00 PM	07 GILBERT RD	Ray Rd		25 No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	2 - South	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	None Used	Speed To Fast For Conditions	0 - No Apparent Influence
3415628	9/17/2018 7:43:00 AM	07 GILBERT RD	Ray Rd		100 No Injury	Motor Vehicle In Transport	Rear End	Daylight	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	2 - South	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Other	0 - No Apparent Influence
3420573	9/19/2018 4:34:00 PM	07 GILBERT RD	Ray Rd		100 No Injury	Traffic Sign Support	Single Vehicle	Daylight	Rain	Four Way Intersection	Intersection Related Interchange	Two Way Divided Positive Median Barrier	1 - North	Making Left Turn	No Contributing Circumstances	Wet	No Contributing Circumstances	No Contributing Circumstances	1	Other Non Fixed Object	Traffic Sign Support	Driver	Shoulder And Lap Belt	Speed To Fast For Conditions	0 - No Apparent Influence
3418875	9/20/2018 8:17:00 AM	07 GILBERT RD	Ray Rd		0 No Injury	Motor Vehicle In Transport	Left Turn	Daylight	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	6 - Northeast	Making Left Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Failed To Yield Right Of Way	0 - No Apparent Influence
3426433	10/19/2018 7:55:00 AM	07 RAY RD	Gilbert Rd		150 No Injury	Motor Vehicle In Transport	Sidewipe Same Direction	Daylight	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	4 - West	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Unsafe Lane Change	0 - No Apparent Influence
3443237	11/13/2018 6:55:00 PM	07 GILBERT RD	Ray Rd		0 No Injury	Motor Vehicle In Transport	Left Turn	Dark Lighted	Clear	Four Way Intersection	Intersection Interchange	Two Way Divided Positive Median Barrier	5 - Northwest	Making Left Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Failed To Yield Right Of Way	0 - No Apparent Influence
3452723	11/27/2018 12:54:00 PM	07 GILBERT RD	Ray Rd		0 Suspected Minor Injury	Motor Vehicle In Transport	Left Turn	Daylight	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	4 - West	Making Left Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Failed To Yield Right Of Way	0 - No Apparent Influence
3459870	12/17/2018 6:39:00 AM	07 RAY RD	Gilbert Rd		25 No Injury	Motor Vehicle In Transport	Rear End	Dark Lighted	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Unprotected Painted 4 Feet Median	4 - West	Going Straight Ahead	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	None Used	Other	0 - No Apparent Influence
3460370	12/20/2018 8:50:00 AM	07 GILBERT RD	Ray Rd		0 Possible Injury	Motor Vehicle In Transport	Left Turn	Daylight	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	5 - Northwest	Making Left Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Air Bag Deployed/Shoulder-Lap Belt	Made Improper Turn	0 - No Apparent Influence
3462451	1/3/2019 6:39:00 AM	07 GILBERT RD	Ray Rd		-10 No Injury	Motor Vehicle In Transport	Sidewipe Same Direction	Dark Lighted	Clear	Not At An Intersection	Not Junction Related	Two Way Divided Positive Median Barrier	1 - North	Overtaking Passing	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Unknown	Unknown	
3473345	1/15/2019 12:18:00 PM	07 GILBERT RD	Ray Rd		0 No Injury	Motor Vehicle In Transport	Left Turn	Daylight	Clear	Four Way Intersection	Intersection Related Non Interchange	Two Way Divided Positive Median Barrier	5 - Northwest	Making Left Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Failed To Yield Right Of Way	0 - No Apparent Influence
3489155	3/1/2019 7:56:00 PM	07 RAY RD	Gilbert Rd		0 No Injury	Motor Vehicle In Transport	Left Turn	Daylight	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	3 - East	Going Straight Ahead	Unknown	Dry	Unknown	Unknown	1	Motor Vehicle In Transport		Driver	Unknown	Disregarded Traffic Signal	
3503337	4/1/2019 8:03:00 PM	07 GILBERT RD	Ray Rd		0 Possible Injury	Motor Vehicle In Transport	Rear To Side	Dark Lighted	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Unprotected Painted 4 Feet Median	3 - East	Making Left Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Unknown	Failed To Yield Right Of Way	0 - No Apparent Influence
3515970	5/4/2019 8:50:00 PM	07 GILBERT RD	Ray Rd		0 No Injury	Motor Vehicle In Transport	Left Turn	Dark Lighted	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	2 - South	Making Left Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Shoulder And Lap Belt	Failed To Yield Right Of Way	0 - No Apparent Influence
3521543	5/31/2019 1:12:00 PM	07 RAY RD	Gilbert Rd		0 No Injury	Motor Vehicle In Transport	Left Turn	Daylight	Clear	Four Way Intersection	Intersection Non Interchange	Two Way Divided Positive Median Barrier	1 - North	Making Left Turn	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Air Bag Deployed/Shoulder-Lap Belt	Failed To Yield Right Of Way	0 - No Apparent Influence
3540924	7/25/2019 1:09:00 PM	07 GILBERT RD	Ray Rd		50 No Injury	Motor Vehicle In Transport	Sidewipe Same Direction	Daylight	Clear	Not At An Intersection	Not Junction Related	Two Way Divided Unprotected Painted 4 Feet Median	1 - North	Unknown	No Contributing Circumstances	Dry	No Contributing Circumstances	No Contributing Circumstances	1	Motor Vehicle In Transport		Driver	Unknown	Unknown	

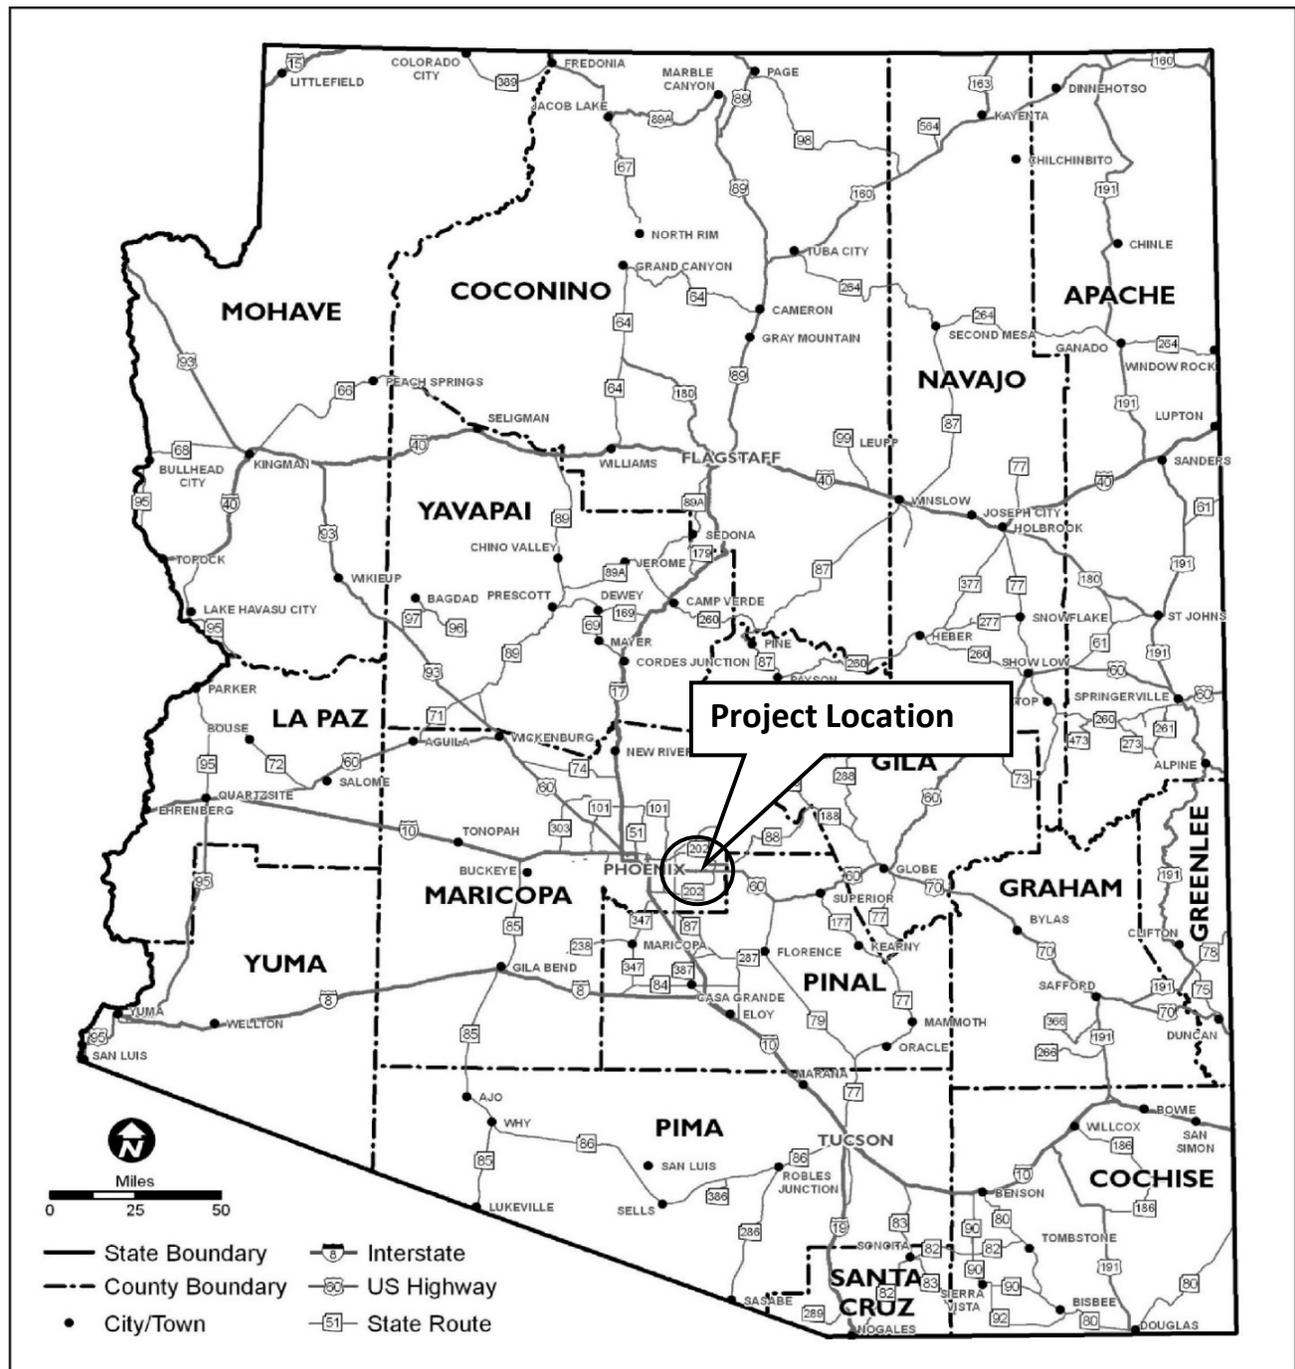

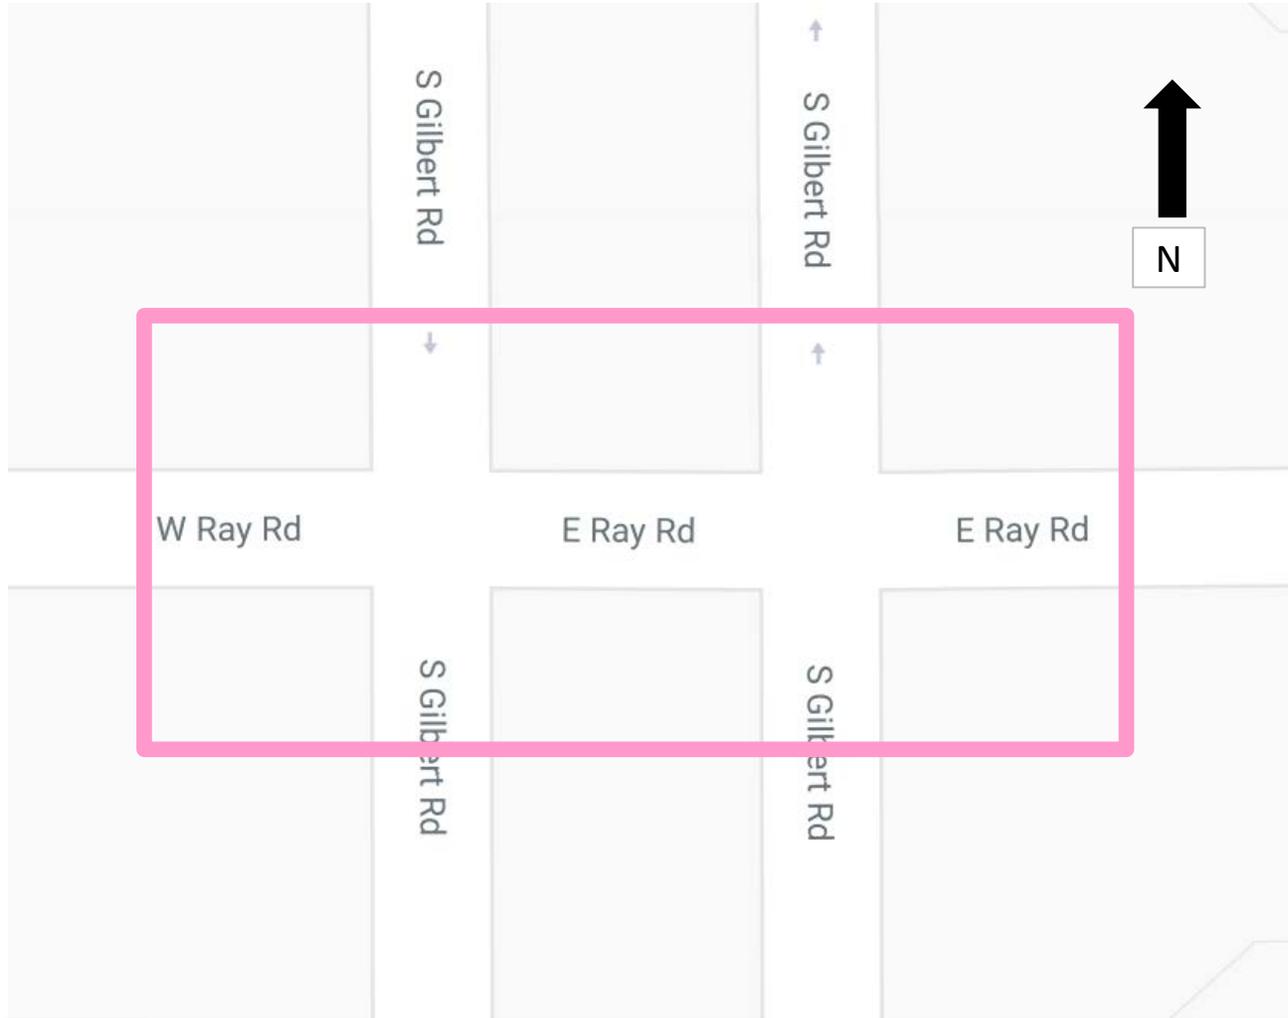

 - Project Limits